

WESTERN ELECTRO - ACOUSTIC LABORATORY

A division of Veneklasen Associates, Inc.

TESTING • CALIBRATION • RESEARCH

25132 Rye Canyon Loop Santa Clarita, California 91355 Tel: (661) 775-3741 Fax: (661) 775-3742 www.weal.com

SOUND TRANSMISSION LOSS TEST REPORT NO. TL14-444

CLIENT: Frametek Steel Products 1495 Columbia Ave., Bldg. 4 Riverside, CA 92507 TEST DATE: 8 December 2014

Page 1 of 2 4 February 2015

INTRODUCTION

The test was performed in accordance with ASTM E 90-09, *Standard Test Method for Laboratory Measurement of Airborne Sound Transmission Loss of Building Partitions* and ASTM E2235-04^{£1}, *Standard Test Method for Determination of Decay Rates for Use in Sound Insulation Test Methods*. Copies of the test standard are available at <u>www.astm.org</u>. The test chamber source and receiving room volumes are 204 and 148.4 cubic meters respectively. Western Electro-Acoustic Laboratory is accredited by the United States Department of Commerce, National Institute of Standards and Technology under the National Voluntary Accreditation Program (NVLAP) Lab Code 100256-0 for this test procedure. This test report relates only to the item(s) tested. This report must not be used to claim product certification, approval, or endorsement by WEAL, NVLAP, NIST or any agency of the federal government.

DESCRIPTION OF TEST SPECIMEN

The test specimen was a wall assembly constructed from metal studs and type X gypsum board. The studs were Prime Stud 92 mm (3-5/8 inch) 24 mil metal and were spaced at 406 mm (16 inches) O.C. The head and sill tracks were Prime Track 92 mm (3-5/8 inch) 24 mil metal. The frame was isolated from the test opening with 6.4 mm (1/4 inch) neoprene pads. Owens Corning R-13 un-faced fiberglass batts, 89 mm (3-1/2 inch) thick, were installed in the stud spaces. On the source room side, one layer of 15.9 mm (5/8 inch) thick USG type X gypsum board was screwed to the studs at 203 mm (8 inches) O.C. around the perimeter and 305 mm (12 inches) O.C. in the field using 28.6 mm (1-1/8 inch) drywall screws. On the receiving room side, two layers of 15.9 mm (5/8 inch) thick USG type X gypsum board were screwed to the studs at 203 mm (8 inches) O.C. around the perimeter and 305 mm (12 inches) O.C. in the field using 28.6 mm (1-1/8 inch) drywall screws on the receiving room side, two layers of 15.9 mm (5/8 inch) drywall screws on the second layer. All gypsum board was oriented vertically and the joints were staggered on opposite sides of the wall and between layers. On both sides, the joints and perimeters were sealed with a bead of caulking and metal foil tape. All screw heads were covered with metal foil tape. The overall dimensions of the wall assembly were 2.44 m (96 inches) high by 140 mm (5-1/2 inches) thick. The overall weight of the assembly was estimated to be 222 kg (489 lbs.) for a calculated surface density of 37.3 kg/m² (7.64 lbs./ft²).

RESULTS OF THE MEASUREMENTS

One-third octave band sound transmission loss values are plotted and tabulated on the attached sheet. ASTM minimum volume requirements are met at 80 Hz and above. The Outdoor-Indoor Transmission Class rating determined in accordance with ASTM E 1332-10a was OITC-33. The Sound Transmission Class rating determined in accordance with ASTM E 413-10 was STC-49.


Approved:

mange

Gary E. Mange Laboratory Director Report must be distributed in its entirety except with written permission from Western Electro-Acoustic Laboratory

Respectfully submitted, Western Electro-Acoustic Laboratory



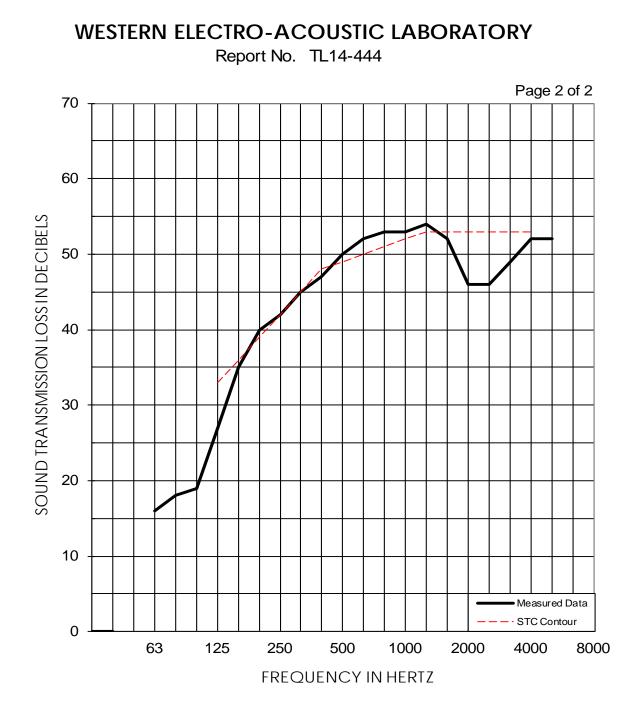

1/3 OCT BAND CNTR FREQ			63	80	100	125	160	200	250	315	400	500
TL in dB			16	18	19	27	35	40	42	45	47	50
95% Confidence in dB			1.42	1.92	2.07	1.47	0.89	0.76	0.80	0.52	0.36	0.38
deficiencies						(6)	(1)		(0)	(0)	(1)	
1/3 OCT BAND CNTR FREQ			630	800	1000	1250	1600	2000	2500	3150	4000	5000
TL in dB			52	53	53	54	52	46	46	49	52	52
95% Confidence in dB			0.29	0.44	0.38	0.39	0.36	0.56	0.55	0.31	0.32	0.50
deficiencies							(1)	(7)	(7)	(4)	(1)	
EWR	ΟΙΤΟ	Test Date: 08 December 2014									STC	
50	33	Specimen Area: 64 sq.ft.									49	
Temperature: 72.3 deg. F										(28)		
Relative Humidity: 36 %												

Report must be distributed in its entirety except with written permission from Western Electro-Acoustic Laboratory

